


## Патроны сверлильные

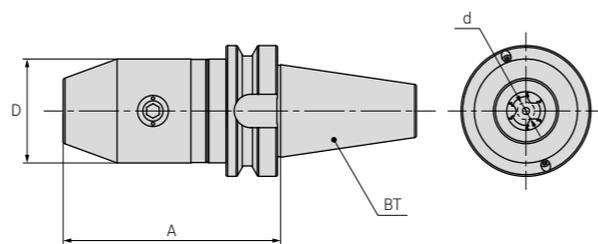


Обозначение	ISO	d мм	A мм	D мм
• 240.078.DC08	BT 40	0–8	78	36
• 240.098.DC13	BT 40	1,0–13	98	50
• 240.103.DC16	BT 40	2,5–16	103	50
• 250.111.DC13	BT 50	1,0–13	111	50
• 250.113.DC16	BT 50	2,5–16	113	50

### Комплектующие

Ключ WH.. стр. 699	Штрель.. стр. 693

## Патроны резьбонарезные с осевой компенсацией

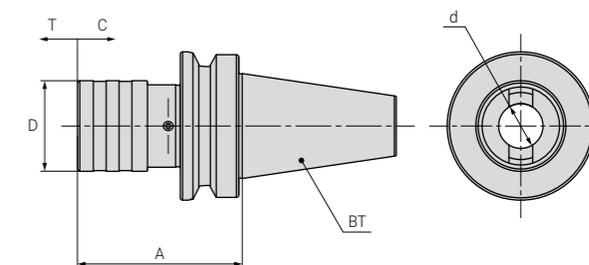

Обозначение	ISO	Резьба	Размер мм	A мм	D мм	d мм	T мм	C мм
• 230.064.TCL19	BT 30	M3–M14	1	64	38	19	7	7
• 230.095.TCL31	BT 30	M5–M22	2	95	54	31	12	12
• 240.065.TCL19	BT 40	M3–M14	1	65	38	19	7	7
• 240.093.TCL31	BT 40	M5–M22	2	93	54	31	12	12
• 240.166.TCL48	BT 40	M14–M36	3	166	78	48	20	20
• 250.100.TCL19	BT 50	M3–M14	1	100	38	19	7	7
• 250.105.TCL31	BT 50	M5–M22	2	105	54	31	12	12
• 250.142.TCL48	BT 50	M14–M36	3	142	78	48	17,5	17,5

### Комплектующие

Адаптер ТС.. стр. 689	Адаптер TCSC.. стр. 691	Штрель.. стр. 693	Переходная быстросменная втулка